YiwuQC

Independent Quality Control in China

ANONYMIZED SAMPLE

PRODUCT INSPECTION REPORT

English demonstration edition | Sample issue date: 18 March 2026

FOR WEBSITE DEMONSTRATION ONLY

This document is an English-language, anonymized reconstruction of a historical inspection worksheet. The date, inspector name, identifiers and selected figures are illustrative. It does not certify a March 2026 inspection.

01 General information

REPORT REFERENCE **YQC-SAMPLE-2026-03**	SAMPLE REPORT DATE **18 March 2026**
INSPECTOR **Lee (sample name)**	INSPECTION SERVICE **Product inspection (PPI template)**
CLIENT / BUYER **Withheld**	SUPPLIER / FACTORY **Withheld**
PRODUCT **Clear textured drinking glass**	INSPECTION LOCATION **China - exact site withheld**

Inspection overview

Inspection basis	Value
Order quantity	4,800 pieces (illustrative)
Ready quantity	4,896 pieces across 102 cartons
Sample checked	500 pieces from 36 cartons
Reference sample	No approved golden sample provided

Facility context photographs

Original imagery retained with facility identifiers irreversibly blurred.




Photo 01 · Facility exterior - anonymized




Photo 02 · Factory entrance - signage obscured

Inspection results

ASSESSMENT AND QUANTITY VERIFICATION

DISPOSITION: CLIENT DECISION REQUIRED

The illustrated defect summary exceeds the zero-critical-defect acceptance allowance. Product acceptance is therefore not confirmed by this sample report.

02 Results by inspection category

Category	Result	Inspector note
Quantity	Checked	Ready quantity differs from order quantity.
Dimensions and weight	Deviation noted	Measured size and weight differ from stated targets.
Appearance / color	Checked	Clear material; visible surface defects documented.
Packaging / marking	Attention	Outer carton wear and sealing concerns.
Functional / laboratory tests	Not performed	No laboratory testing evidence provided.
Defect assessment	Hold	Critical, major and minor defects observed.
Special customer requirements	None provided	No separate signed checklist available.

03 Quantity verification

Order / ready	Cartons	Sample
4,800 ordered / 4,896 ready	100 planned / 102 ready	500 pcs / 36 cartons



Photo 03 · Units in inner carton



Photo 04 · Product side view



Photo 05 · Base decoration



Photo 06 · Product in hand

Dimensions and weight

MEASUREMENTS FROM THE SOURCE WORKSHEET

04 Product measurements

Parameter	Target / reference	Sample reading	Assessment
Width × height	82 × 93 mm	84 × 93 mm	Dimensional variation
Net product weight	Approx. 310 g	Approx. 285 g	Below reference
Carton dimensions	Not specified	Approx. 53 × 38 × 22 cm	Recorded
Carton gross weight	Not specified	Approx. 14.7 kg	Recorded

Units are presented in practical product-measurement notation for this illustrative English edition.

Measurement evidence



Photo 07 · Width measurement



Photo 08 · Height measurement



Photo 09 · Caliper reading



Photo 10 · Weight sample 1



Photo 11 · Weight sample 2



Photo 12 · Weight sample 3

Appearance and packaging checks

COLOR, CONSTRUCTION AND TRANSPORT PACKING

05 Color, design and construction

Characteristic	Expectation	Observation
Product color	Transparent / clear	Clear material observed
Product shape and design	Match supplied specification	General appearance checked; dimensional deviation noted
Printing / placement	Not applicable	No printed decoration requirement established
Spelling / fonts	Not applicable	No printed text for verification

Appearance photographs



Photo 13 · Overall appearance



Photo 14 · Base and finish



Photo 15 · Surface construction

06 Packaging and marking

Control	Observed result
Individual packaging	No special vent, desiccant or individual mark was specified.
Group packaging	Six units per group; 48 units per outer carton.
Transport marking	Carton marking checked; source identifiers hidden in this edition.
Carton condition	Some master cartons appeared reused or damaged; sealing was a concern.
Palletization	Pallet wrapping proposed. Warehouse housekeeping and ventilation also required improvement.

Packaging photo evidence

CARTONS, PALLET, INNER PACKAGING | 1 OF 2

07 Packaging visual record



Photo 16 · Carton on weighing scale



Photo 17 · Carton weight detail



Photo 18 · Open inner packing



Photo 19 · Pallet stacking



Photo 20 · Closed outer carton



Photo 21 · Carton identification obscured

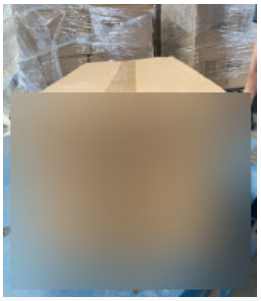


Photo 22 · Transport marking obscured



Photo 23 · Outer marking obscured

Commercial codes, shipping identifiers and labeling details have been obscured in the corresponding photographs.

Packaging photo evidence

CARTON CONDITION, MEASUREMENTS | 2 OF 2

08 Packaging visual record (continued)

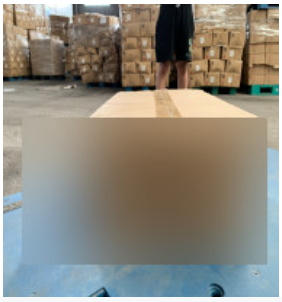


Photo 24 · Outer carton - codes obscured



Photo 25 · Open internal compartments



Photo 26 · Carton insert arrangement

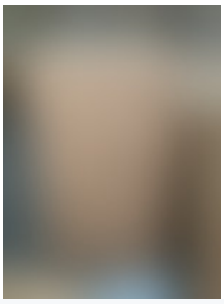


Photo 27 · Shipping-label details obscured



Photo 28 · Carton measurement A



Photo 29 · Carton measurement B

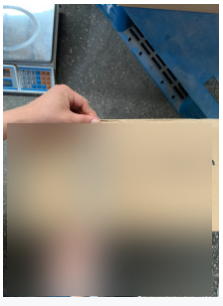


Photo 30 · Carton markings obscured



Photo 31 · Gross carton weight

Photo content is preserved where practical; sensitive factory and shipment identifiers are permanently blurred.

Defect assessment

DEFECT CATEGORIES AND ACCEPTANCE LIMITS

09 Sampling reference and outcome

Reference	Observed / stated
Sampling plan	ANSI/ASQ Z1.4; General Inspection Level I
AQL (critical / major / minor)	0 / 2.5 / 4.0
Inspected quantity	500 pieces in 36 sampled cartons
Critical / major / minor found	4 / 11 / 3 (illustrative adjusted summary)
Stated acceptance limits	0 / 15 / 26 (as listed in source template)
Inspection disposition	On hold; buyer action required

10 Defect register

Defect description	Severity	Qty
Fine cracks	Major	4
Visible cracks	Critical	1
Bubbles / inclusions	Critical	2
Surface streaks	Major	4
Spot / contamination	Major	1
Long scratch	Major	2
Deformed base	Critical	1
Minor rim chips	Minor	3

Individual counts have been normalized for internal consistency in this demonstrative reconstruction.

Defect evidence (1 of 3)



Photo 32 · Fine cracks



Photo 33 · Fine cracks



Photo 34 · Visible cracks

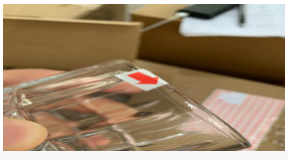


Photo 35 · Visible cracks

Defect photo evidence

SURFACE IRREGULARITIES AND VISIBLE DEFECTS | 2 OF 3

11 Defect visual record



Photo 36 · Bubbles / inclusions



Photo 37 · Bubbles / inclusions



Photo 38 · Bubbles / inclusions



Photo 39 · Bubbles / inclusions



Photo 40 · Surface streaks

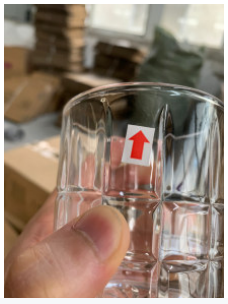


Photo 41 · Surface streaks



Photo 42 · Surface spot



Photo 43 · Long scratch

Defect severity is illustrative and must be interpreted against the buyer-approved specification and actual sampling protocol.

Final observations

DEFECTS, SPECIAL REQUIREMENTS AND USAGE RESTRICTIONS

12 Defect visual record (3 of 3)



Photo 44 · Base deformation



Photo 45 · Base deformation



Photo 46 · Edge chips



Photo 47 · Edge chips

13 Functional and laboratory tests

Test category	Status
Performance or laboratory tests	No verified test results in the historical worksheet.
Chemical / safety compliance	Not assessed; no compliance claim is made.

14 Special requirements and sample collection

Item	Outcome
Additional customer requirements	None separately supplied for this example.
Samples for lab analysis	No recorded quantity.
Samples shipped to client	No recorded quantity.
Accepted / defect samples retained	No recorded quantity.

15 Inspector conclusion

DECISION PENDING

Critical defects exceeded the illustrative acceptance allowance. Product dimensions, weight and outer-carton condition should be reviewed by the buyer before any release decision.

DISCLAIMER: Findings in this demonstration are adapted from a past worksheet and anonymized. The example does not replace a signed inspection report, buyer/seller obligations, independent laboratory testing, or the buyer's rights in relation to apparent or hidden defects.